

Liquifit Tube to tube fittings

How to build Part Numbers

6305 56 11GP2 = quantity of order 10 pcs
 6305 56 11GP3 = quantity of order 100 pcs
 6305 56 11GP4 = quantity of order 1000 pcs



How to determine color codes



6366 Reducer




D1	D2		P2	P3	P4	G	L	L1	oz
1/4	5/16	6366 56 08WP2	10	100	1000	0.43	1.61	0.89	.063
1/4	3/8	6366 56 60WP2	10	100	1000	0.43	1.61	0.81	.075
3/8	1/2	6366 60 62WP2	5	50	500	0.63	2.01	1.04	.163
1/4	5/16	6366 56 08GP2	10	100	1000	0.43	1.61	0.89	.063
1/4	3/8	6366 56 60GP2	10	100	1000	0.43	1.61	0.81	.075
3/8	1/2	6366 60 62GP2	5	50	500	0.63	2.01	1.04	.163

6382 Plug in elbow



D1	D2		P2	P3	P4	G	H	H1	H2	L	oz
1/4	1/4	6382 56 00WP2	10	100	1000	0.43	1.20	0.43	0.83	0.73	.050
3/8	3/8	6382 60 00WP2	10	100	1000	0.63	1.52	0.35	0.96	1.02	.159
1/2	1/2	6382 62 00WP2	5	50	500	0.87	2.00	0.51	1.12	1.38	.416
1/4	1/4	6382 56 00GP2	10	100	1000	0.43	1.20	0.43	0.83	0.73	.050
3/8	3/8	6382 60 00GP2	10	100	1000	0.63	1.52	0.35	0.96	1.02	.159
1/2	1/2	6382 62 00GP2	5	50	500	0.87	2.00	0.51	1.12	1.38	.416

6388 Plug in branch tee

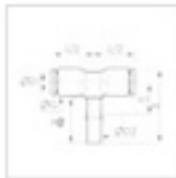

D	D2		P2	P3	P4	G	H	H1	H2	L/2	oz
1/4	1/4	6388 56 00WP2	10	100	1000	0.43	0.98	0.43	0.77	0.73	.085
3/8	3/8	6388 60 00WP2	10	100	1000	0.63	1.61	0.35	0.96	0.98	.288
1/2	1/2	6388 62 00WP2	5	50	500	0.87	2.01	0.51	1.12	1.38	.710
1/4	1/4	6388 56 00GP2	10	100	1000	0.43	0.98	0.43	0.77	0.73	.085
3/8	3/8	6388 60 00GP2	10	100	1000	0.63	1.61	0.35	0.96	0.98	.288
1/2	1/2	6388 62 00GP2	5	50	500	0.87	2.01	0.51	1.12	1.38	.710